

# STEP PULLEYS

## MAS



### FEATURES:

- Commonly used with drill presses & wood lathes
- All bores come with 2 set screws
- Designed for A, 4L & 3L V-Belts
- Models of 3 to 5 steps
- From 2" to 6" diameter

### HOW TO ORDER

EXAMPLE: **MAS62X1/2**

**M**   **AS**   **62** X   **1/2**

**M:**      MASKA LIGHT DUTY FAMILY

**AS:**      STEP PULLEY SERIE


**62:**      OUTSIDE DIAMETERS

THE FIRST DIGIT REPRESENTS THE LARGEST  
OUTSIDE DIAMETER (6")

THE SECOND DIGIT REPRESENTS THE SMALL-  
EST OUTSIDE DIAMETER (2")

**1/2:**      BORE SIZE (1/2")

**FIXED BORE, STOCK SIZES  
FOR 3L-4L (A) V-BELTS**

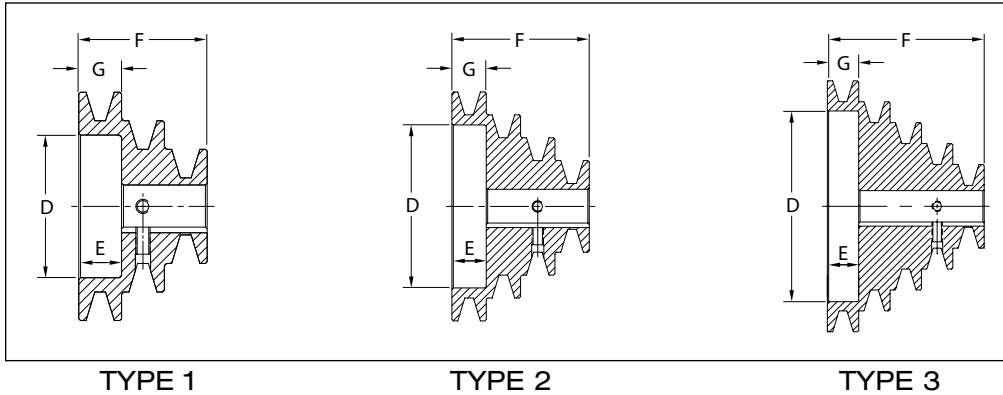

**DIMENSIONS**

Part No	List Price \$	Type	Outside Diameters	Stock Bores	Dimensions (inches)				Wt
					D	G	F	E	
MAS62	91.80	3	6" 5" 4" 3" 2"	1/2 · 5/8 · 3/4 · 7/8	4-9/16	3/4	3-3/4	3/4	8.0
MAS63	78.80	2	6" 5" 4" 3"	1/2 · 5/8 · 3/4 · 7/8 · 1 · 1-1/8	4-9/16	3/4	3	3/4	7.5
MAS64	65.30	1	6" 5" 4"	1/2 · 5/8 · 3/4 · 7/8 · 1 · 1-1/8	4-9/16	3/4	2-1/4	3/4	6.5
MAS52	67.30	2	5" 4" 3" 2"	1/2 · 5/8 · 3/4 · 7/8	3-9/16	3/4	3	3/4	4.5
MAS53	56.60	1	5" 4" 3"	1/2 · 5/8 · 3/4 · 7/8 · 1 · 1-1/8	3-9/16	3/4	2-1/4	3/4	4.2
MAS42	46.10	1	4" 3" 2"	1/2 · 5/8 · 3/4 · 7/8	2-1/2	3/4	2-1/4	3/4	2.3

D.D. for "A"(4L) belts = O.D. - .25"

P.D. for "A"(4L) belts = O.D.

D.D. for 3L belts = O.D. - .59" P.D. for 3L belts = O.D. - .34"

**Keyseat Information**

Bore Range	Keyseat
1/2"	None
5/8" to 7/8"	3/16" X 3/32"
15/16" to 1-1/4"	1/4" X 1/8"